



SERVICE BULLETIN NUMBER: AX2012

ISSUE 1

PAGE 1 OF 1

TITLE AX2000 TOW LINE

CLASSIFICATION This service bulletin has been classified as COMPULSORY by Cyclone Airsports.

COMPLIANCE Before further flight.

APPLICABILITY Cyclone AX2000 aircraft, reg. G-MZER, G-MZLM and G-MZHR

INTRODUCTION

An accident has occurred whereby the towline wore thin and broke between the ballrace swivel and the drogue, whilst in flight. This caused the ballrace swivel, connected between the maillon rapide at the apex of the V-Bridle and the main towline, to catapult towards the towing aircraft and strike the tailplane.

ACTION

Remove ballrace swivel from V-Bridle apex and move to in front of drogue parachute, see Figure 1. Check towline for wear before each flight and replace if necessary.

ISSUED BY W.G.BROOKS	S. TUDDENHAM	DATE	26.3.98
Signed Production Director	C.N.BEALE	Date	27.3.98
Signed Quality Manager/Sales Director	J.FACK	Date	27.3.98
Signed Managing Director	W.H.SHERLOCK	Date	27.3.98



ELM TREE PARK, MANTON, MARLBOROUGH, WILTSHIRE SN8 1PS, UK
Tel: +44 (0)1672 861578 Fax: +44 (0)1672 861550 E Mail: pegasus@cccp.net