
mainair sports

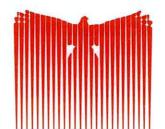

MAINAIR SPORTS LIMITED Alma Industrial Estate Rochdale, Lancashire, England. OL12 0HQ. Tel.(0706) 55134 Telex 635091 ALBION G ATTEN.MAIN

Date: 1st July, 1985

Our Ref:

Your Ref:

BULLETIN NO.16.

REFERENCE FLASH WINGS.

It has been brought to our attention that the control frame sides can rub against the Trike upright when the wing is left parked with one wing on the ground.

We have a modification which will greatly eliminate this problem by replacing the existing control frame ear brackets with a new style type which gives a greater width at the apex. Replacement is straight forward and is a simple matter of unbolting the ear brackets changeing over the bolts and re-fitting. The geometry remains exactly the same and the work will take about 15 minutes.

Replacement wide ear brackets are available free of charge but we must insist on a large stamped addressed envelope and machine Serial No. All machines delivered during May and June have the new style brackets but owners of early machines can identify the ear brackets as follows:

Old style - manufactured from $1\frac{1}{4} \times 1\frac{1}{4} \times 1/8$ Aluminium Channel.

New style - manufactured from $1\frac{1}{2} \times 1\frac{1}{2} \times 3/16$ Channel.

We recommend all owners changeover these ear brackets to eliminate the fretting problem.

John Hudson (Director).

